

SPECIFICATION SHEET

Protective Clothing



KOSTO
BUILT STRONG • BÂTI SOLIDE

AluSkin

Aluskin Coverall for Aluminum Smelter and Welding with 4" reflective tape

VCKA01

The fabric of AluSkin garments offers optimum protection for workers exposed to molten metals, such as smelters and welders, by protecting them against splashes, flames and heat. It also provides category 2 protection for workers exposed to electric arc hazards. The blend of comfortable, lightweight fabric and the garment's snug fit make AluSkin the ideal protective garment. The coverall complies with the CSA standard for tape positioning.

Certifications

- This garment is certified with **NFPA 70E / ASTM F1506 (ASTM F1959)** specifications for arc flashes and flame resistant clothing (**Cat. 2 ATPV 12 cal/cm²**)
- **EN11612 (A1 A2 B1 C1 D3 E3 F1)** for the resistance to heat, flame and molten splash
- **EN ISO 11611 (Class 2 - A1+A2)** for protection against welding projections
- Antistatic **EN1149-5**
- Comply with **CSA Z96-22** for tape position **Class 3, Level 2**

Fabric

- 54% FR Viscose / 20% Polyamide / 20% Wool / 5% Aramid / 1% Antistatic 330 gsm (9.73 oz/yd²)
- FR 4" reflective tape Tested: EN ISO 20471 / EN ISO 533

Size:

XS to 4XL



High collar with velcro closure



2 radio straps

Two front pockets with flap & Velcro

Two-way zipper with flap & velcro closure



Slash pocket with access to pant

Side leg opening With certified metal zip



FR 4" reflective tape
Tested: EN ISO 20471 / EN ISO 533

Elastic at the waist for more comfort

Back pocket with Velcro closure

Adjustable cuffs with Velcro

Heavy Nomex resistant thread and reinforced seams at stress points



SPECIFICATION SHEET

Protective Clothing

AluSkin



KOSTO
BUILT STRONG • BĀTI SOLIDE

Related Items

VHKA60
CSA Aluskin
Shirt



VHKA01+VPKA3
Shirt & Pant
Aluskin




VCKAD6
Aluskin
for women



Care Guide

Care Instructions

- Protective garments should be cleaned regularly, as per recommended instructions.
- Wash all garments after fixing all closure systems.
- Strictly wash garments inside out.
- Always wash your Flame Retardant PPE separately to avoid some migration of flammable loose fibers or components.
- Please make sure that garments are properly rinsed after wash.
- Do not dry in direct sunlight as this may cause color to fade.
- After cleaning the garment, please inspect before re-use




Wash care instructions

- Wash in 60°C, do not use detergents containing soap & chlorine.
- Do not bleach, or use acids when rinsing.
- Iron at low setting (below 110°C).
- Use dry cleaning agent other than Trichloroethylene.
- Tumble dry allowed.

Size Chart

VCKA01
REGULAR

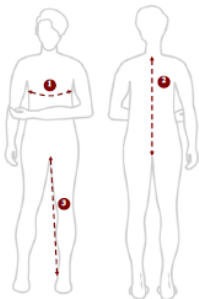

		SECURITY COVER ALL								
			XS	S	M	L	XL	2XL	3XL	4XL
Poirtrine / Chest	1	po / in	42	44	48	52	56	60	64	68
		cm	106	111	121	132	142	152	162	172
Longueur / Body length	2	po / in	34.25	35.5	36.75	38	39.25	40.5	41.75	42.75
		cm	87	90	93	96	99	102	106	108
Jambe / Inseam	3	po / in	31	31	31	31	31	31	31	31
		cm	79	79	79	79	79	79	79	79

* Measurements are based on finished garment. * For optimal fit it is recommended to try before purchase

PROTECTION · RELIABILITY · VALUE